



HOSHIZAKI AMERICA, INC.

SERVICE BULLETIN

SB00-0002

August 2, 2000

Page 1 of 2

Subject: GEAR MOTOR FUSE CHANGE FOR F-1000M

Recent field failures have shown that the gear motor fuse blows easily if the gear motor amperage increases slightly. The current fuse is specified as a GMD1.5 amp Hoshizaki part number 4A0893-04. This fuse operates normally in mid range applications and provides extra safety as a quick shutdown if the bin control sticks closed. It will easily blow however, if the temperatures rise or fall to the outside of the operating temperature specifications.

SB00-0002

August 2, 2000

Page 2 of 2