



HOSHIZAKI AMERICA, INC.

SERVICE BULLETIN

SB07-0001

January 5-2007

Page 1 of 1

Subject: KM-501MAH DIP SWITCH SETTING CHANGE.


Effective December 2006 the factory setting for DIP switch numbers 1 and 2 have been changed for the KM-501MAH series of ice makers. The new setting is DIP switch number 1 in the OFF position and number 2 in the ON position. This will change the defrost completion time from 60 seconds to 120 seconds.

If you are experiencing freeze up issues on these units, we are suggesting that a freeze up check list be completed (SB03-0003) If no other problems which could cause a freeze up are found, you should adjust DIP switch 1 and 2 to the new factory setting shown above.

In many cases this type of failure has been misdiagnosed as a defective float switch, bin fill switch or water valve.

A good rule of thumb would be to adjust these DIP switches to the new setting any time you are servicing or performing preventative maintenance on a KM-501 produced before December 2006. Serial numbers (R_ _ _ _N)

If you have any questions concerning this issue please call Technical Support at 1-800-233-1940.

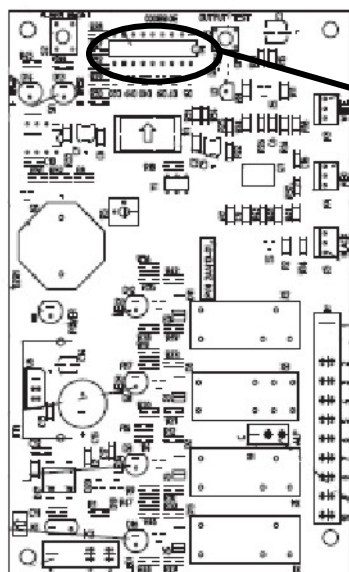

DIP Switch location.

CONTROL BOARD