



HOSHIZAKI AMERICA, INC.

SERVICE BULLETIN

SB07-0005R1

Revised May 19, 2008


Page 1 of 1

Subject: KM FLOAT SWITCH REDESIGN

A recent design was made to the internal float of the float switch assembly. The current part number for the internal float (4A0886F02) was replaced by (4A3624F02). This new float is fully interchangeable and will sub when existing inventory is depleted. Current complete assembly part number (4A0886-01) now subs to (4A3624-01).

(A) Increased surface area:

Increased guide surface area and decreased guide inside diameter, will stop side to side movement preventing possible sticking during operation.

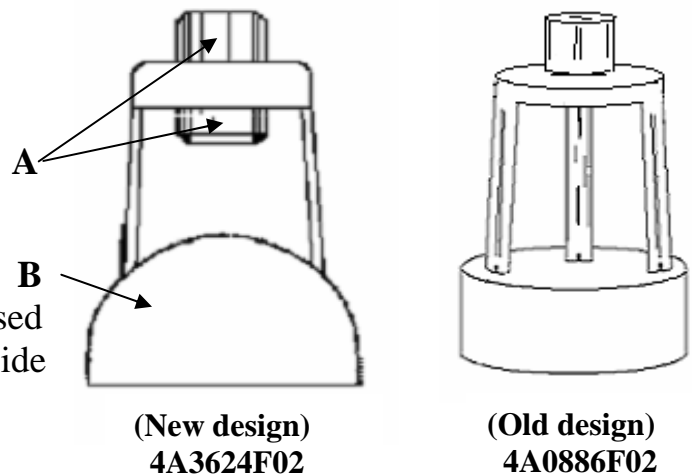

(A) New material and dome shape:

The new redesigned dome shape and change in material will reduce mineral build up by allowing water to “slide” off the top.

If you have any questions regarding this information please contact the Tech Support department at: 1-800-233-1940