



# **HOSHIZAKI AMERICA, INC.**

## **SERVICE BULLETIN**

**SB19-0002**

October 30, 2019

Page 1 of 1

### **Subject: KM-1100MAJ50 (50 Cycle) Pump motor capacitor**

It has been brought to our attention that early production of the KM-1100MAJ50 series may have been manufactured with the wrong pump motor capacitor. The affected serial numbers are J00158F and earlier.

This units were manufactured with a 5.5MFD capacitor instead of the correct 10.0MFD.

If you have customers that have these units, it is recommended that the pump capacitor be replaced with part number 4A6435-01.

Possible symptoms may include, the pump motor not operating resulting in 3 beep errors or long freeze times.

If you have any questions concerning this change, please contact the Technical Support Department at [tech-support@hoshizaki.com](mailto:tech-support@hoshizaki.com) or 1-800-233-1940.