

HOSHIZAKI AMERICA, INC. SERVICE BULLETIN

SB22-0005R1

Issued: August 22 2022 Revised June 14, 2023 Page 1 of 2

Subject: "S" Suffix Evaporator Kits

Update: The original shortage that prompted the development of the "S" suffix evaporator kits has subsided. These kits will soon be phased out.

Original Service Bulletin: Due to material shortages and supply chain issues Hoshizaki has created additional evaporator service kits. These new service kits use components that are more readily available and will allow us to increase production of evaporators used for service.

When replacing an existing evaporator with one of the new "S" suffix kits, it will be necessary to turn DIP switches number 1 & 2 to the "ON" position. All other DIP switches should be set in their normal position. Please reference the individual models service manuals for correct DIP switch settings

In most cases ice production and unit efficiency will be affected by approximately 8% after installing these evaporators and moving DIP switches 1 and 2 to the "ON" position.

| Original kit number | "S" suffix kit number | Models |
|----------------------|---------------------------|----------------|
| SP-5358 | SP-5358S | KM-901M_J |
| (4 Evap set) | (4 Evap set) | KM-1100M_H/M_J |
| SP-5360 | SP-5360S | KM-340M_H/M_J |
| | | KM-515M_H/M_J |
| (2 Evap set) | (2 Evap set) | KM-650M_J |
| SP-5361 | SP-5361S | KM- |
| | | 1340M_H/M_J/3 |
| | | KM- |
| (4 Evap Set) | (4 Evap Set) | 1601M_H/M_J/3 |
| SP-5371 | SP-5645S | KM-1900S_J3 |
| | | KM-2200S_J3 |
| *Note: (This is a 3 | | KM-2600S_J3 |
| evaporator bank fits | | KMH-2100S_J3 |
| either left or right | (6 Evap set includes left | |
| side | and right) | |
| SP-5425 | SP-5425S | KM-350M_J |
| | | KM-520M_J |
| (2 Evap set) | (2 Evap set) | KM-660M_J |
| SP-5430 (Left side) | SP-5644S | KM-1301S_J |
| SP-5431 (Right side) | | KM-1601SJ |
| | | |
| *Note: These are 3 | | |
| evaporator banks. | | |
| Order appropriate | (6 Evap set includes left | |
| side | and right) | |
| | | |

If you have question concerning this Service Bulletin, please contact the Technical Support department techsupport@hoshizaki.com or 1-800-233-1940.