



HOSHIZAKI AMERICA, INC.

SERVICE BULLETIN

SB98-0007

July 08, 1998

Subject: Redesigned Bin Control Bracket For KML Models

The bin control bulb bracket for all KML models has been redesigned. This is to reposition the bulb location, allowing better ice contact when the bin is full. The new location results in less possibility for **ice back up** which can cause a freeze-up condition. It will be included on future units production.

If you have experienced ice back up on units installed prior to this memo, first check the bin control for proper operation. If the bin control shuts the unit down correctly (within 6 to 10 seconds with ice contacting the bulb), you likely have a bulb location problem. In this case, contact the Technical Support Department at 800-233-1940 and request Extension Bracket Replacement # HS-0128 to replace the original bin control bracket. You will need to provide the complete model and serial number and unit location when you request the parts. They will be shipped at no charge.

HS-0128 includes the following parts.

1. 4A1722-01 THERMOSTAT EXTENSION BRACKET
2. 425307-01 CAPILLARY RING
3. 443545-01 SPACER
4. SB98-0007 SERVICE BULLETIN

Installation instructions:

To install the new bracket, access the ice drop zone through the access cover, loosen the thumbscrews, slide the original bracket back and lift it out of the ice drop zone. Transfer the bulb to the new bracket using the capillary ring and spacer, and use the original thumbscrews to secure the new bracket in the same position.

