



HOSHIZAKI AMERICA, INC.

SERVICE BULLETIN

SB99-0012

June 29, 1999

Subject: Incorrect Amount on Charge Label for F-800 MWF.

The charge amount on the nameplate label for the F-800 MWF is incorrect. The charge amount is listed as 15.9 oz. R-404A. The actual charge for this unit is 12.9 oz. R-404A. The units were charged correctly during manufacturing and should operate normally. The only concern will be if the refrigeration system is serviced and the incorrect charge is used. The extra charge will likely cause high head pressures and low production. This mistake was corrected on all but 70 units that may be in a distributors warehouse or in operation in the field.

If you are called on to service a F-800 MWF in the following serial number range, use a permanent marker and correct the charge amount on the nameplate to 12.9 oz.

Effected serial numbers: H00026L ~ H00045L & J00046B ~ J00095B

NOTE: The correct refrigerant charge amount for the F-800MWF is 12.9 oz. R-404A