



HOSHIZAKI AMERICA, INC.

SERVICE BULLETIN

SB12-0001R1


Revised March, 12 2012

Page 1 of 1

SUBJECT: Change in KM Series Cleaning Valve.

Beginning in March 2011 the manual cleaning valve assembly for the KM series has changed. The two male adaptors have changed design and this new design no longer requires the use of the O-ring 7611-P018. The O-rings have been eliminated and the adaptors are now sealed by Teflon thread tape. Note: In the event of a water leak around the male adaptor do not try to tighten further. Remove male adaptor, apply new thread seal tape and re-install adaptor. Care should be taken not to over tighten adaptor as cracking may occur.

See below for a diagram of the new assembly and current part numbers.

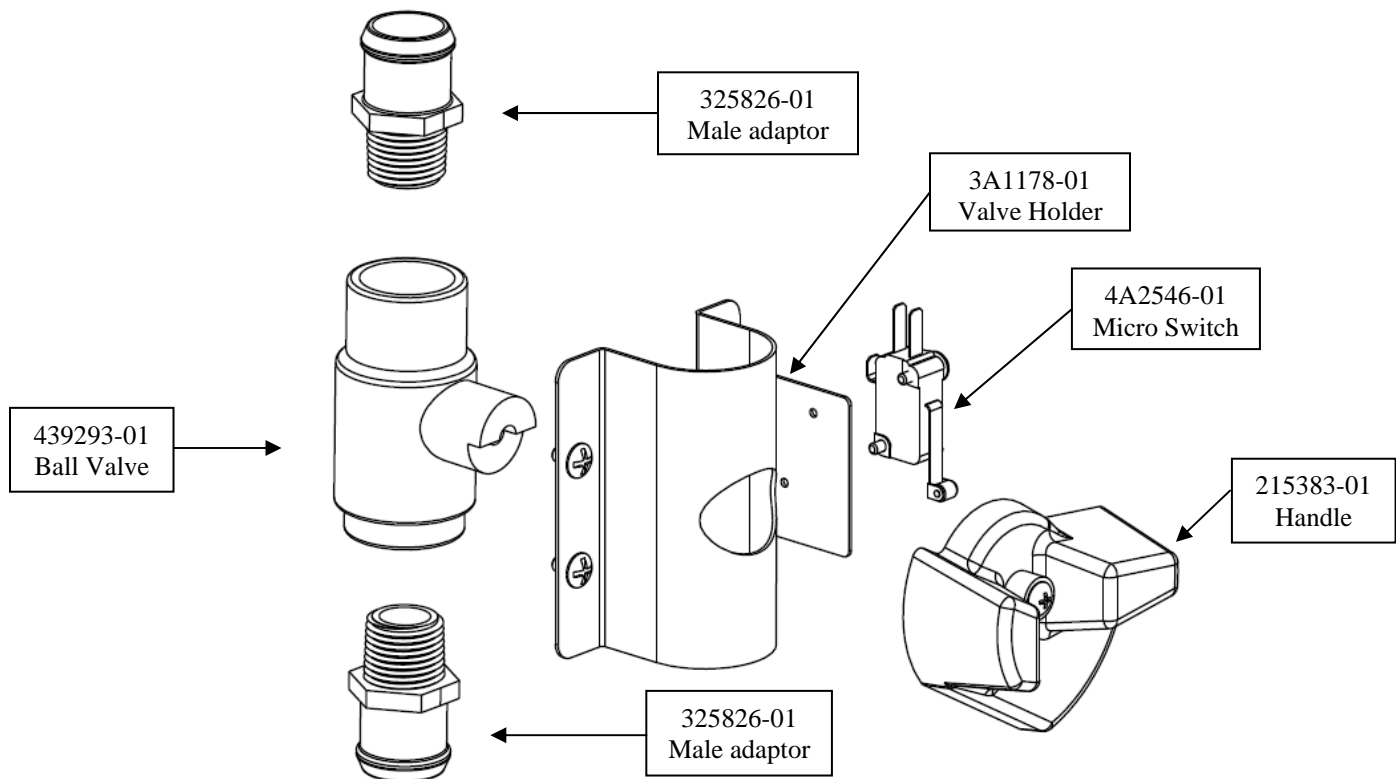

If you have any questions concerning this change please contact Hoshizaki technical support at 1-800-233-1940.