

HOSHIZAKI AMERICA, INC. SERVICE BULLETIN

SB94-0004

March 24, 1994

SUBJECT: DISCONTINUED PARTS


Listed below are two fan motors for the older KM series units which are no longer available from the manufacturer. These parts will substitute as shown in the chart below.

If a replacement fan motor is ordered, the fan blade must be replaced at the same time due to a difference in the motor shaft size. An additional new bracket must be ordered for the S-0466 remote condenser application.

MODEL NUMBER	OLD FAN MOTOR PART NUMBER	NEW PART NUMBERS MOTOR/BLADE/BRACKET 2U0090-01/421462-01/		
KM-451DU	2U0064-01			
KM-601D	11		11	91
KM-631DU	H erman production of the second	**	, 11	**
KM-1201DU	n	**	11	**
S-0466	200064-02	2U0090-02/417068-01/		
S-0454	11	2U0090-02/417068-01/318052G02		

Order replacement parts per model number as listed above.

The new fan motor has 4 leads and should be wired according to the following diagram.

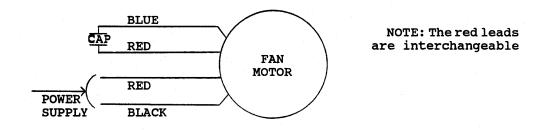

DM/ss