



HOSHIZAKI AMERICA, INC.

SERVICE BULLETIN

SB10-0008

September 29, 2010

Page 1 of 2

Subject: HOT GAS VALVE AND STRAINER

The strainer is a protection device for the HGV. When replacing the HGV, it is required to replace the strainer and filter drier on all units. Look for direction arrow on strainer and insure that it is pointing at the inlet of HGV.

*Note: All warranty claims for replacing HGV must also replace the strainer and drier. All warranty parts must be returned to the distributor with the claim. Repairs not including strainers and drier are incomplete and may be denied.



MODEL	STRAINER	HOT GAS VALVE	DRIER
KML-250MWH	441569-02	3U0151-01 w/coil	4A2666-01
ALL OTHER KML--- M_H	441569-02	4A3978-01	4A2666-01
KMD-410 M_H	P00812-01	4A3978-01	462965-01
KMD-450M_H	441569-02	4A3978-01	4A1113-01
KMD- 850, 901 M_H	441569-02	4A3978-01	4A2666-01
KM-61, 101BAH	P00008-01	3A2949-01	P00007-01
KM-151B_H	P00008-01	3A2949-01	P00026-01
KM-201,260 B_H	P00812-01	4A3978-01	P00026-01
KM-320 M_H	441569-01	3U0151-01 w/coil	4A2666-01
KM-515 M_H	441569-01	4A3978-01	4A2666-01
KM-600M_H to KM-1340M_H	441569-02	4A3978-01	4A2666-01
KM-1601MRH (3)	441569-02	4A3978-01	4A2663-01
KM-1300S_H TO KM-1301S_H	441569-02	4A3978-01	4A2666-01
KM-1601S_H TOKM-2500S_H	441569-02	4A3978-01	4A2663-01
KMH-2000SRH (3)	441569-02	4A3978-01	4A2663-01

Note: See page 2 for additional information concerning KML series strainers


Subject: HOT GAS VALVE AND STRAINER

KML series units built prior to the serial numbers below do not have a strainer at the inlet of hot gas valve. The strainer is located in the discharge line 4 way (H) fitting. This fitting is difficult to remove and replace in the field. In these cases leave the discharge line as is and add the strainer 441569-02 at the inlet of the HGV.

Model	Serial
KML-250MWH	V _ _ _ _ _ C
KML-250MAH	V _ _ _ _ _ A
KML-351MAH	U _ _ _ _ _ J
KML-451M_H	U _ _ _ _ _ G

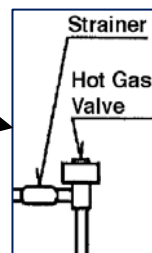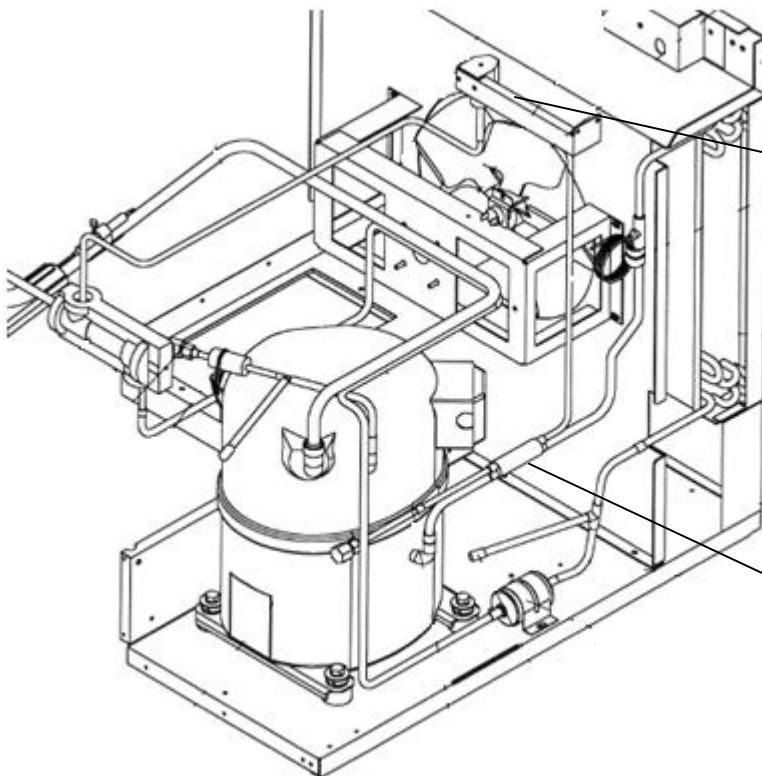

Typical location for additional strainer (441569-02).

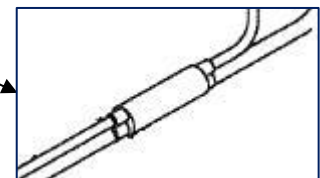

Existing 4 way (H) style strainer (4A0397-01).