



HOSHIZAKI AMERICA, INC.

SERVICE BULLETIN

SB14-0005

March 6, 2014


Page 1 of 1

SUBJECT: Flaker Timer Board 437305-01 & 437305-02 No Longer Available

Previous timer board's 437305-01 & 437305-02 now subs to new timer board 4A5591-01. Although 4A5591-01 has additional features, the operational sequence is the same as 437305-01&-02 and terminal connections remain the same. The new board has LED's to show the mode of operation and dip switches to adjust bin control shut down timing. This board is a universal replacement for part number 437305-01 & 02.

LED'S: The board has three LED's and they are labeled PWR [power], GM [gear motor] and CM [compressor motor]. The power LED will blink meaning power OK. The GM and CM LED'S will be lit meaning the component is in operation.

Dip Switches: This board has four dip switches. At this time the only adjustment will be dip switch #1. For all flaker models the dip switch #1 will be in the ON position and 2-4 will be OFF. For the DCM-270BAH operation all four dip switches will be in the OFF position.

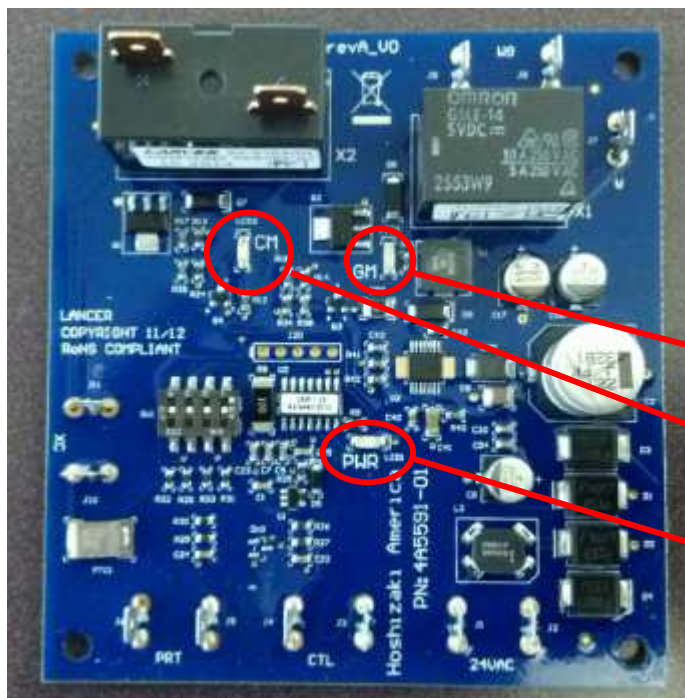

Dip Switches	1	2	3	4
DCM-270BAH	OFF	OFF	OFF	OFF
All Other Flakers	ON	OFF	OFF	OFF

GM LED lights when Gear Motor is energized.

CM LED lights when Compressor is energized.

PWR LED blinks when Power is OK

If you have any questions on this issue please contact Technical Support at Tech-support@hoshizaki.com or 1-800-233-1940.