



HOSHIZAKI AMERICA, INC.

SERVICE BULLETIN

SB15-0007

May 1 2015

Page 1 of 3

Subject: Shutter solenoid 3U0095-01 will be NLA.

Shutter solenoid 3U0095-01 is no longer manufactured by the supplier. This change will also make the following shutter assemblies obsolete as well 2A0410A01/A02/A03/A04. This solenoid and these assemblies were used on multiple models. See the chart below for proper sub routines.

MODEL	SERIAL	OLD SOLENOID	OLD SHUTTER ASSY	MODIFICATION NEEDED	NEW SHUTTER ASSY	NEW SOLENOID
DCM-230	ALL	3U0095-01	2A0410A02	NO	2A6131A02	4A0856-01
DCM-300	ALL	3U0095-01	2A0410A01	NO	2A6131A01	4A0856-01
DT-400	ALL	3U0095-01	2A0410A01	NO	2A6131A01	4A0856-01
DCM-450	ALL	3U0095-01	2A0410A01	NO	2A6131A01	4A0856-01
DCM-500	ALL	3U0095-01	2A0410A01	NO	2A6131A01	4A0856-01
DCM-700	ALL	3U0095-01	2A0410A03	YES	2A6131A03	4A0856-01
DCM-750	ALL	3U0095-01	2A0410A03	YES	2A6131A03	4A0856-01
DCM-751	C-L & EARLIER	3U0095-01	2A0410A04	YES	2A6131A03	4A0856-01

DCM-700, 750 and DCM-751 with serial numbers C _ _ _ _ L and earlier will need additional modification when using the new shutter assembly. For modification instructions see page 2.

For models that do not require mounting modification skip to page 3

In both applications see page 3 for wiring.

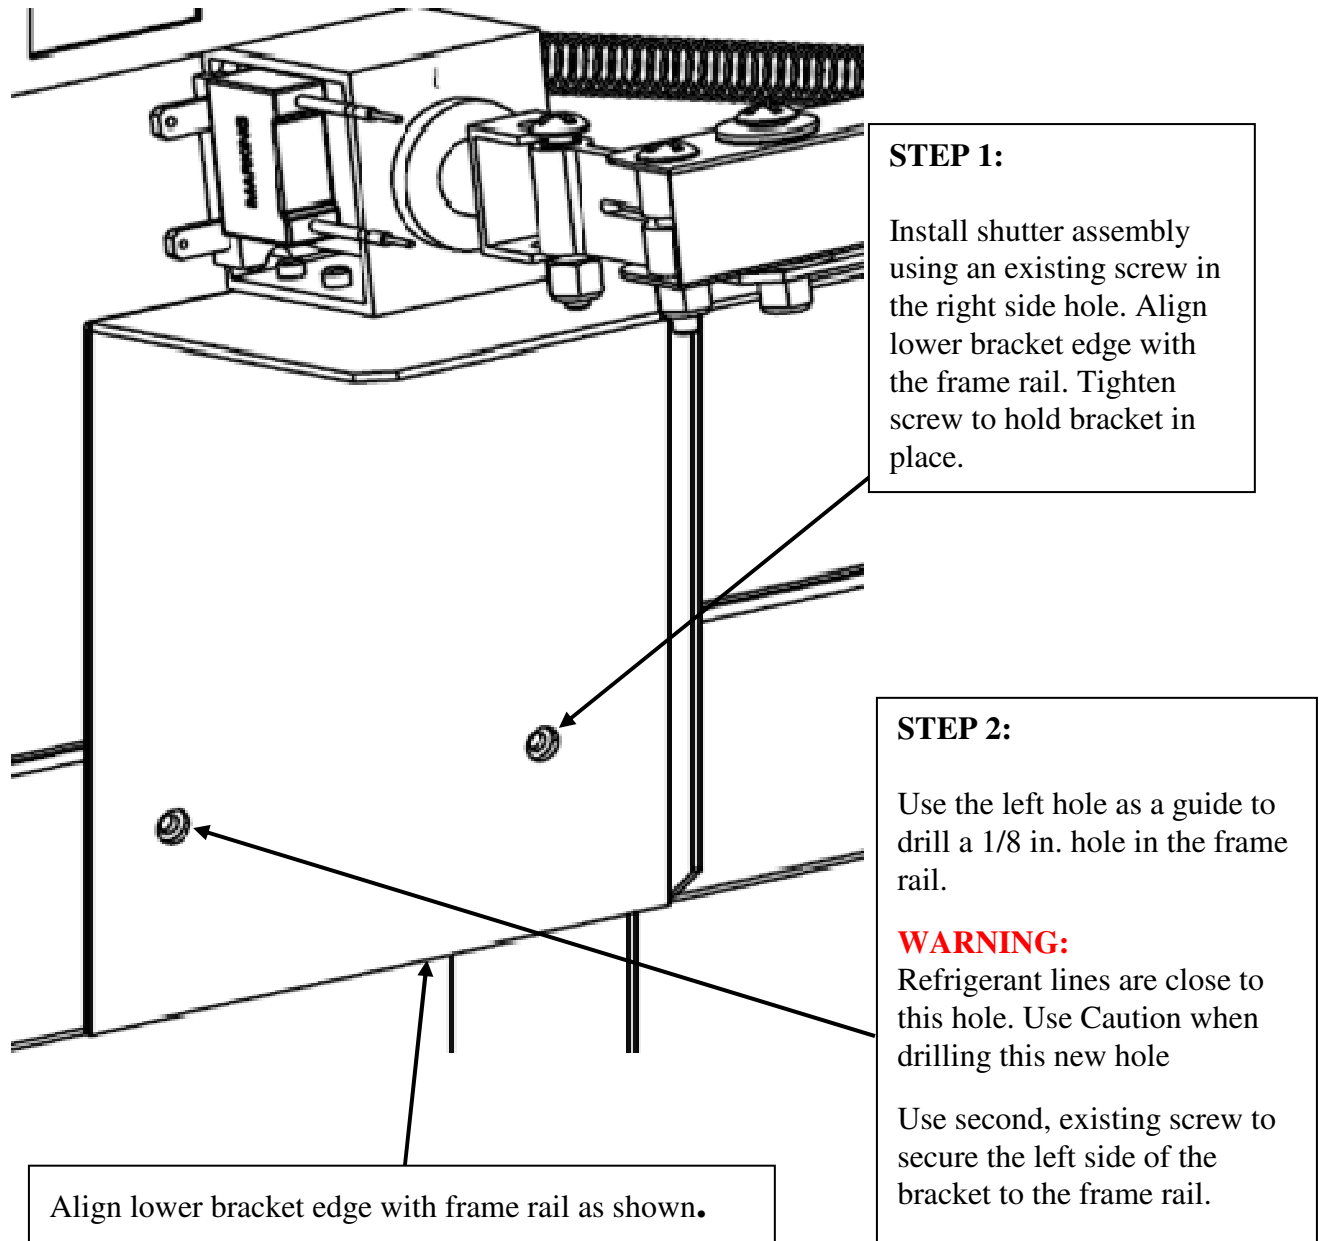


Fig. 1

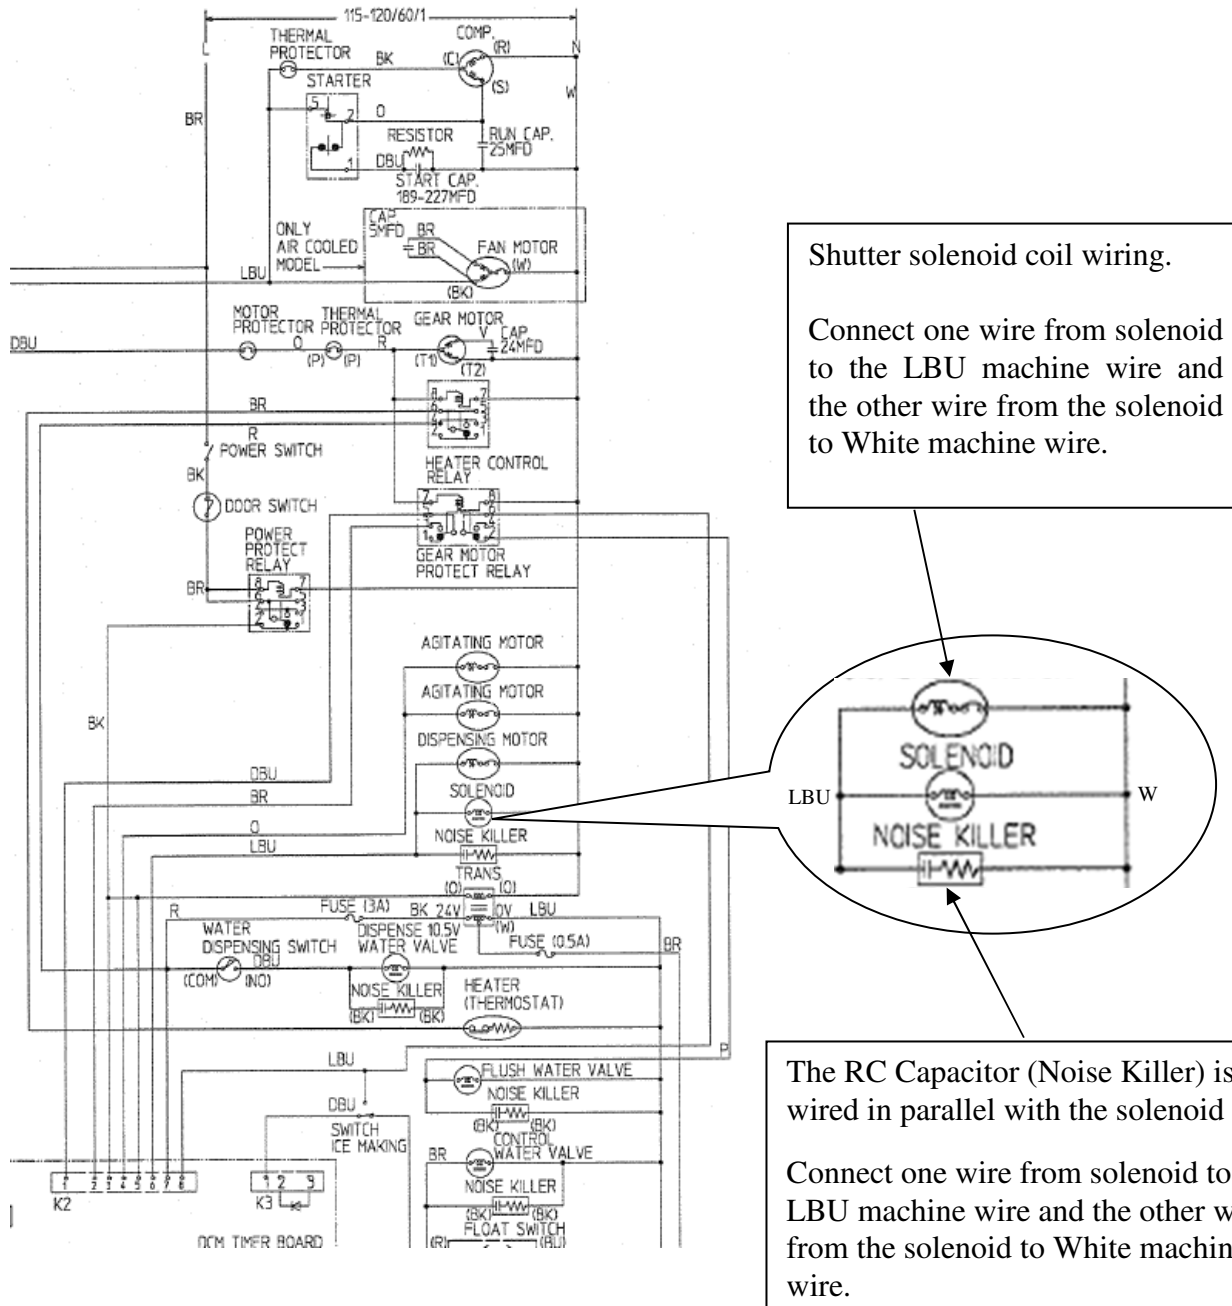


Fig. 2

If you have any questions about installing and / or modification of the shutter assembly. Contact Technical Support for assistance at Techsupport@hoshizaki.com or 1-800-233-1940.