



HOSHIZAKI AMERICA, INC.

SERVICE BULLETIN

SB16-0002R1

Issued May 9, 2016

Revised February 20 2017

Page 1 of 2


Subject: New replacement board 2A8054-01 will replace 2A4296-01, 2A4296-02 and 2A8053-01

The 2A8054-01 has been developed and is a universal replacement for Flaker/DCM control boards 2A4296-01, 2A4296-02 and 2A8053-01. Note: Dipswitch settings may be different with 2A8054-01 from previous boards.

This is not a replacement board for units built with control board 437305-01 or 4A5591-01.

F-C Series Board DIP Switch Setting Chart										
Factory Dip Switch Settings:	Switch Code 1=ON 0=OFF									
Model / Serial code	1	2	3	4	5	6	7	8	9	10
F-1001M_H (-C)	OFF	OFF	OFF	OFF	OFF	OFF	OFF	ON	ON	OFF
F-1001M_J (-C)	OFF	OFF	OFF	OFF	OFF	OFF	OFF	ON	ON	OFF
FD-650M_H (-C)	ON	OFF	OFF	OFF	OFF	OFF	ON	ON	OFF	OFF
F-801M_J (-C)	ON	OFF	OFF	OFF	OFF	OFF	ON	ON	OFF	OFF
FD-1001M_J (-C)	ON	OFF	OFF	OFF	OFF	OFF	ON	ON	OFF	OFF
FS-1001MLH-C	ON	OFF	OFF	OFF	OFF	OFF	ON	ON	OFF	OFF
FS-1022MLH-C	ON	OFF	OFF	OFF	OFF	OFF	ON	ON	OFF	OFF
FS-1500MLH-C	ON	OFF	OFF	OFF	OFF	OFF	ON	ON	OFF	OFF
F-1501M_H (-C)	ON	OFF	OFF	OFF	OFF	OFF	ON	ON	OFF	OFF
F-2001M_H (-C)	ON	OFF	OFF	OFF	OFF	OFF	ON	ON	OFF	OFF
DCM-270BAH	OFF	OFF	OFF	OFF	ON	OFF	OFF	OFF	OFF	OFF
DCM-270BAH-OS	OFF	OFF	OFF	OFF	ON	OFF	OFF	OFF	OFF	OFF
DCM-751B_H	OFF	OFF	OFF	OFF	ON	ON	OFF	ON	OFF	OFF
DCM-751B_H-OS	OFF	OFF	OFF	OFF	ON	ON	OFF	ON	OFF	OFF

2A8054-01 Printed on board between
relays and K2 connector

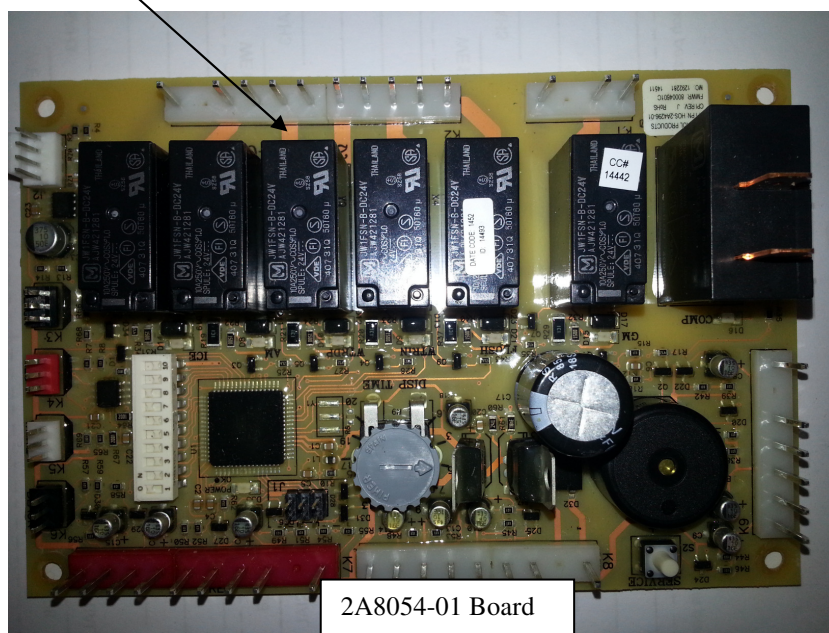

If you have any questions concerning this change, please contact tech-support@hoshizaki.com or 1-800-233-1940