



HOSHIZAKI AMERICA, INC.

SERVICE BULLETIN

SB17-0006

May 23, 2017

Page 1 of 3

Subject: AM-50 Board 463046-01 subs to SP-5257


***** Note: This bulletin supersedes SB13-0003R1*****

The original AM-50BAE board is no longer available. Therefore, service kit SP-5257 has been created to allow the use of the current control board.

This conversion will require modification to the existing control box and wiring and should only be done by a qualified service technician. The service kit includes a drilling template as well as new wiring label.

Example of instruction/drilling template and wiring label has been provided with this Service Bulletin. Note: The provided drilling template is not to scale.

If you have any questions concerning this change, please contact the Technical Support Department at tech-support@hoshizaki.com or 1-800-233-1940.

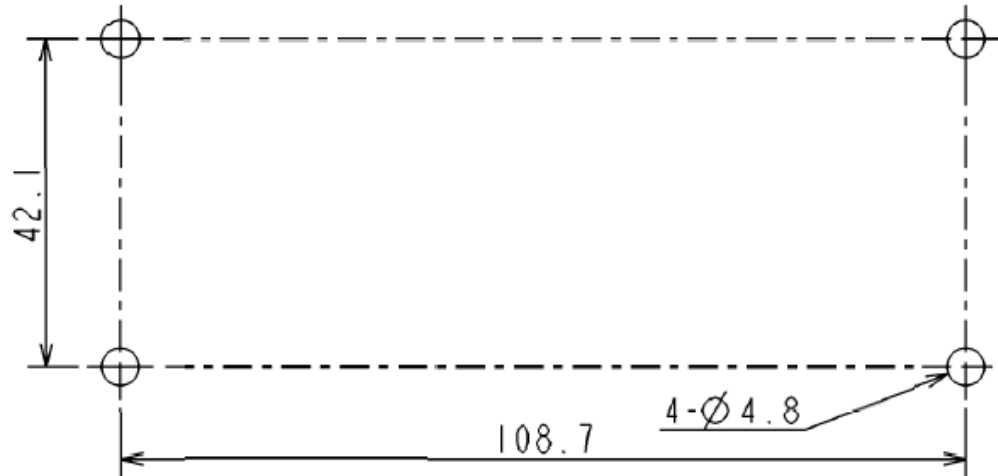

WARNING! DISCONNECT POWER TO ICE MACHINE BEFORE STARTING.

INSTRUCTIONS:

1. REMOVE CONTROL BOX COVER
2. DISCONNECT WIRING TO CONTROL BOARD AND REMOVE CONTROL BOARD.
3. REMOVE SCREW HOLDING CAPACITOR.
4. REMOVE CONTROL BOX FROM ICE MACHINE.
5. LOCATE TEMPLATE ON OUTSIDE AND DRILL (4) Ø4.8 (.188) HOLES AND (2) Ø3.2 (.125) HOLES. DEBURR HOLES.
6. INSTALL NEW BOARD SUPPORTS AND CONTROL BOARD.
7. INSTALL TRANSFORMER USING T2 SCREWS IN Ø3.2 HOLES.
8. REINSTALL CAPACITOR.
9. REWIRE PER 3A9472-01 WIRING LABEL.

