

HOSHIZAKI AMERICA, INC.

SERVICE BULLETIN

SB93-0009R

March 14, 1994

SUBJECT: CHANGE IN WATER SUPPLY SYSTEM

A recent design change was made in the water distribution system to incorporate a cleaning plug and a material change. This results in a reduction in the number of parts for the total distribution system and simpler removal and reassembly for cleaning. The change is effective on the KM-450/630/800 models.


The new parts are interchangeable as a set only. The old parts will remain available for service parts replacements, however, the clear material for the water spray tube will be changed to a cream colored ABS.

The change over was made beginning with the serial numbers listed below:

KM-450MAB	C44601 ----->	KM-630MAE	C30306 ----->
MWB	C44406 ----->	MWE	C30306 ----->
MRB	C30511 ----->	MRE	C30506 ----->
KM-500M_E	ALL	KM-800MAE	C20156 ----->
		MWE	C20156 ----->
		MRE	C20254 ----->

OLD PARTS

NEW PARTS

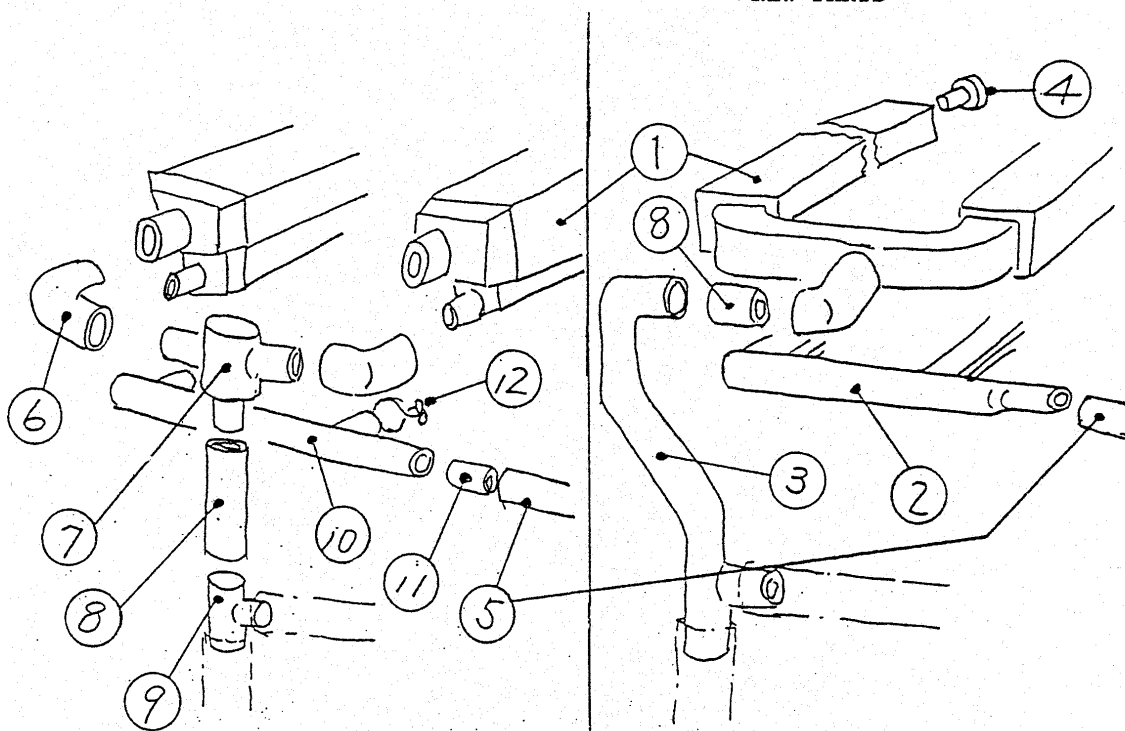

NO.	PARTS DESCRIPTION	OLD PART #	QTY	NEW PART #	QTY
1	SPRAY TUBE	433520G01/02	2	1A0019-01	1
2	WATER SUPPLY TUBE	----	-	2A0079-01	1
3	CONNECTING PIPE	----	-	2A0088-01	1
4	PLUG	----	-	4A0176-01	2
5	TEE	439197-01	1	4A0177-01	1
6	ELBOW	433467-01	2	----	-
7	DISTRIBUTOR	432820-01	1	----	-
8	VINYL HOSE	7716-2025	1	7716-2025	1
		165 MM LONG		50 MM LONG	
9	DISTRIBUTOR	432426-01	1	----	-
10	DISTRIBUTOR HOSE	439374-01	1	----	-
11	JOINT PIPE	439329-01	1	----	-
12	HOSE CLAMP	427443-07	2	----	-