



HOSHIZAKI AMERICA, INC.

SERVICE BULLETIN

SB09-0005R1

Issued May 22, 2009

Updated December 22, 2009

Page 1 of 1


Subject: KML- WATER PUMP CHANGE.

Beginning in June, 2009 the KML series water pump manufacture will change. The new part number will be 4A4259-01. In addition to the new pump an additional 2.5 MFD capacitor (4A2128-05) will be added to the control box. This new pump is not interchangeable with the current pump motor assembly.

HS-0232 service kit is now available for KML units built prior to this date. This service kit includes the new motor, capacitor and instructions for the conversion. Former KML pump kits HS-0180 and HS-0212 will sub to HS-0232 once inventories are depleted.

Below are the starting serial numbers for the new pump as well as the new wiring diagram showing the additional capacitor. If you have any questions concerning this change please contact Technical Support department at 1-800-233-1940

KML-250MAH	U17988G,	KML-351MAH	U10501G,
KML-250MWH	U11361G,	KML-351MWH	U10171G,
KML-451MAH	U17176H	KML-631MAH	U11226G,
Plus 2 units, U07024F and U07025F,		KML-631MWH	U10206G,
KML-451MWH	U11376J,	KML-631MRH	U10351G

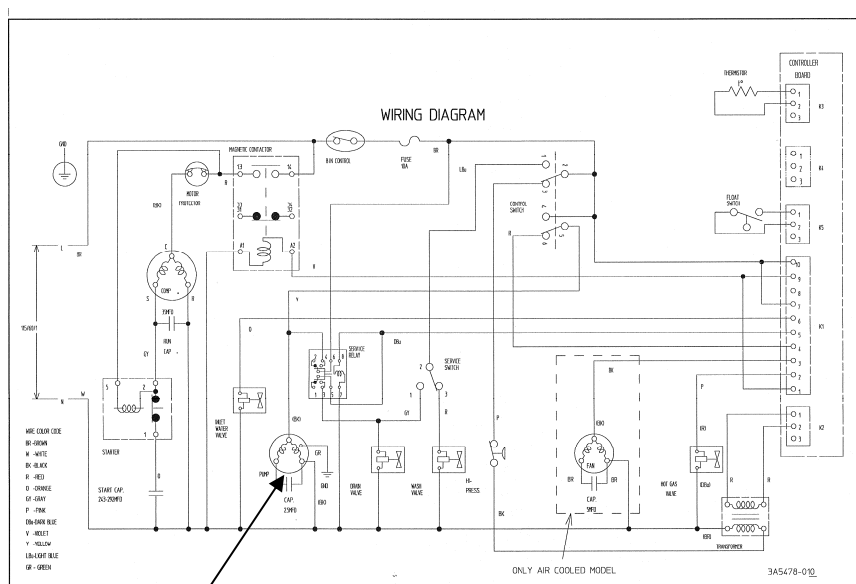

New pump capacitor (4A2128-05)