



# HOSHIZAKI AMERICA, INC.

## SERVICE BULLETIN

**SB94-0010**

August 8, 1994

Page 1 of 2

**SUBJECT: CHANGE IN WATER SUPPLY SYSTEM**


The design change to the water supply system previously introduced on the KM-500/630/800M models (See SB93-0009R) has now been incorporated in the KM-1200/1600M models.

Different parts are needed on these models because of the additional evaporator plates. The new parts are interchangeable as a set only. The old parts will remain available for service replacement, however, you have the ability to change to the new system if desired. To do so, you must order all of the new parts excluding the parts marked same. See chart and drawing on Page 2.

The change is effective beginning the the serial numbers listed below.

KM-1200MAE	D10506H ----->
KM-1200MWE	D20256H ----->
KM-1200MRE	D11756G ----->
KM-1600MRB	D20291F ----->
KM-1600MRB3	D20311F ----->
KM-1600MRE	All

DM/ss

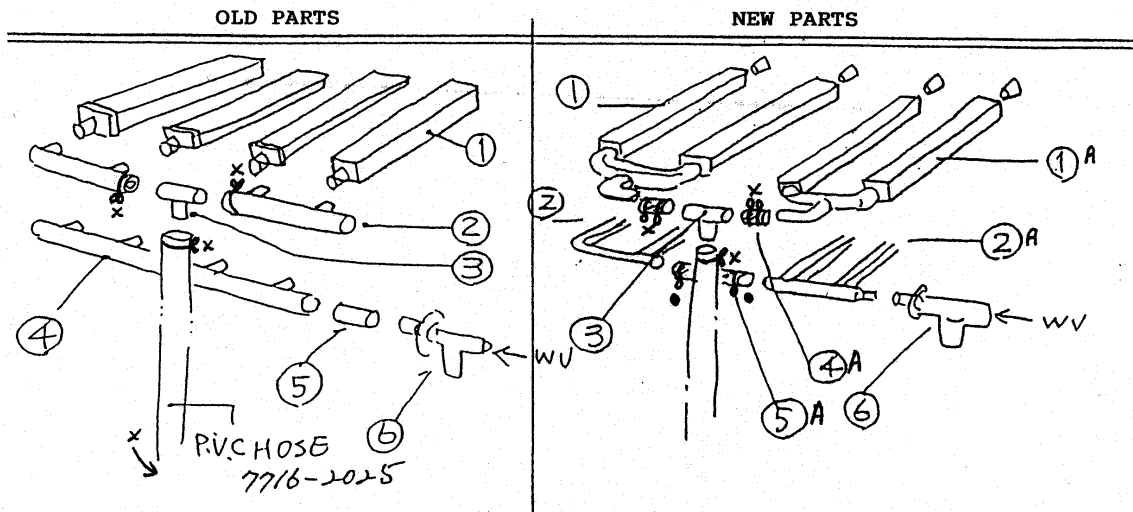

NO.	PARTS DESCRIPTION	OLD PART #	QTY	NEW PART #	QTY
1	Spray Tube	433520G01	4	1A0019-01	1
1A	Spray Tube	-----		1A0019-02	1
2	Distributor Hose	432432-01	2	2A0079-01	1
2A	Distributor Hose	-----		2A0079-02	1
3	Distributor	432426-01	1	Same	1
4	Distributor Hose	325933-01	1	-----	
4A	Hose	-----		7716-2025L55	2
5	Joint Pipe	439329-01	1	-----	
5A	Hose	-----		7616-1216L30	1
6	Tee	439197-01	1	4A0177-01	1
7	Plug	-----		4A0176-01	4
8	Clamps (x)	427443-08	4	Same	6
9	Clamps (.)	-----		427443-03	
Other clamps not shown are interchangeable or not used					